

Assembly instruction

Series N/C

AB 01.11.01
4605/GLS

No. 03063

Tools and materials required :

Stanley blade

Scissors

Crimp tool (see table below)





straight connectors for flexible cable

Cable entry : SUHNER Full-Crimp

Connector types : (e.g.)

25 N-50-3-6	25 N-50-3-7		
24 N-50-3-11	24 N-50-3-12		
21 N-50-3-7	21 N-50-3-8	21 N-50-4-3	
11 N-50-3-12	11 N-50-3-33	21 N-75-4-8	21 N-75-4-9
11 C-50-3-7	11 C-50-3-8	11 N-75-4-8	11 N-75-4-9


This connector is supplied in 3 parts.	suitable cables e.g. :	RG 58C/U	RG 223/U	RG 59B/U	G 04233 D
	Centre contact :	cavity 2	cavity 2	cavity 2	cavity 2
	Braid :	cavity B	cavity B	cavity C	cavity C
	Crimp tool :	2 B (orange)	2 B (orange)	2 C (yellow)	2 C (yellow)

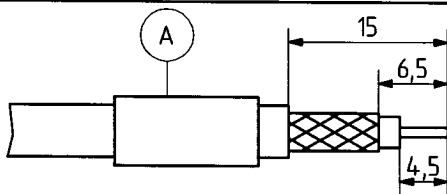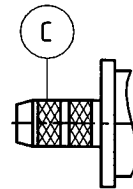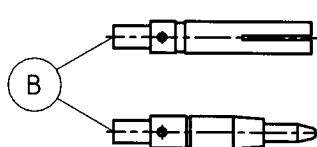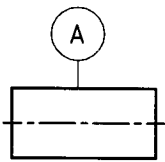


Slide ferrule A onto cable.

Prepare cable according to diagram.


CAUTION: Do not damage braid, dielectric and inner conductor of cable!

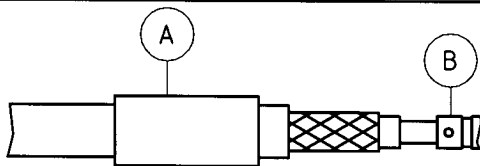

Push contact B over inner conductor to abut cable dielectric and crimp.

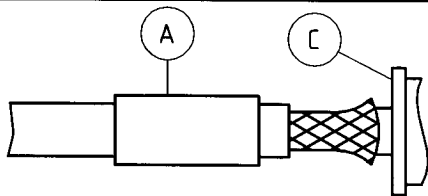

Splay out braid and insert cable in connector body C until contact B engages perceptibly. Ensure that braid lies above the crimp neck.

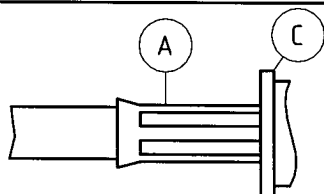

Slide ferrule A over braid and crimp as close to connector body C as possible.

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F. lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text siehe Rückseite